



Thank you for purchasing this Simplicity pattern.
We have made every effort to provide you with a high quality product

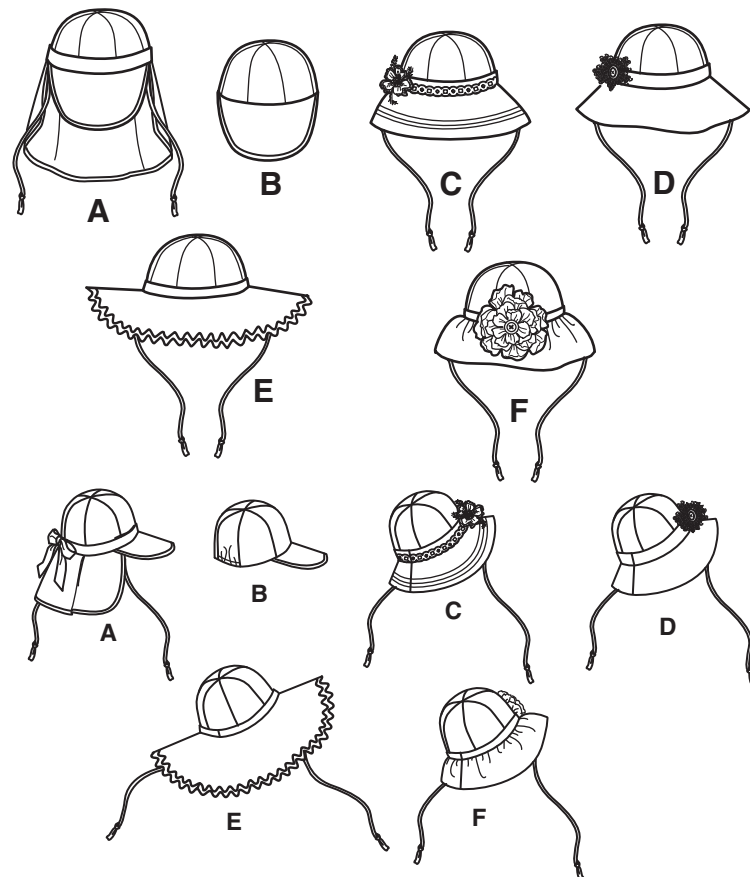


Sign-up for our **free** newsletter today at **simplicity.com**

12 pieces given

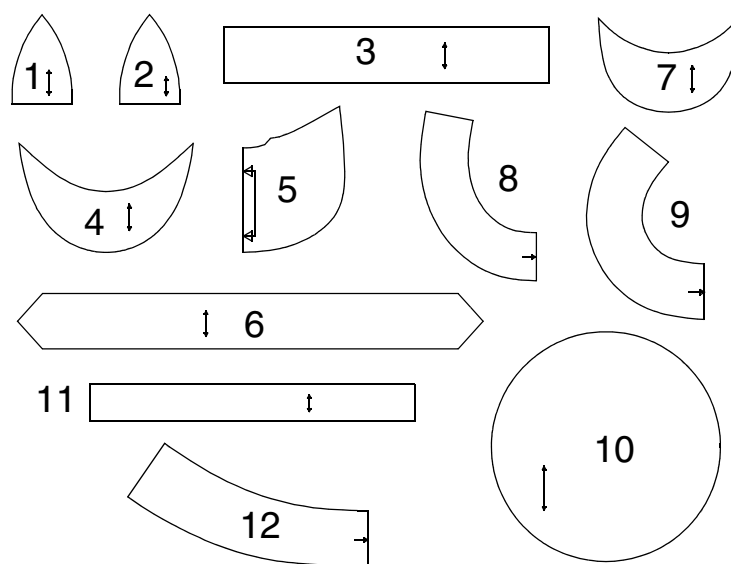

- 1-HAT FRONT AND BACK -A,B,C,D,E,F
- 2-HAT SIDE -A,B,C,D,E,F
- 3-HAT BAND -A,C,D
- 4-FRONT PEAK -A
- 5-BACK FLAP -A
- 6-TIE BOW -A
- 7-FRONT PEAK -B
- 8-HAT BRIM -C
- 9-HAT BRIM -D
- 10-HAT BRIM -E
- 11-HAT BAND -E,F
- 12-HAT BRIM -F

Cutting Layouts

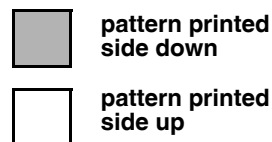

POSITION OF PATTERN PIECES MAY VARY SLIGHTLY ACCORDING TO YOUR PATTERN SIZE

General Directions For Cutting

PRE-SHRINK and iron all fabric.

FOR DOUBLE THICKNESS-Fold fabric with **RIGHT** sides together. Pin pattern to **WRONG** side of fabric.


FOR SINGLE THICKNESS-Pin pattern to **RIGHT** side of fabric.

★ If layout shows a piece extending past fold, cut out all pieces except piece that extends. Open out fabric to single thickness. Cut extending piece on **RIGHT** side of fabric in position shown.

✱ Mark small arrows along both selvages indicating direction of nap or design. Fold fabric crosswise with **RIGHT** sides together, and cut along fold. Turn one fabric layer around so arrows on both layers go in the same direction. Place **RIGHT** sides together.


A HAT

USE PIECES 1 2 4 5
44" 45" (115CM)
WITH NAP
ALL SIZES

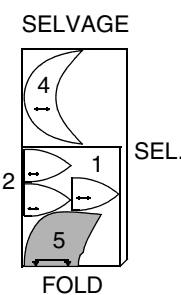

CONTRAST


USE PIECES 1 2 3 4 5 6
44" 45" (115CM)
WITH NAP
ALL SIZES

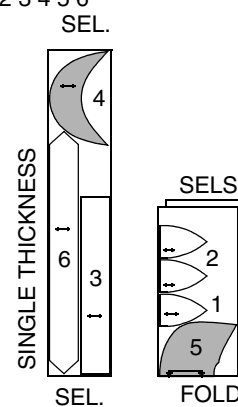

INTERFACING


USE PIECES 1 2 4 5

20" TO 25" (51CM TO 64CM) FUSIBLE
ALL SIZES

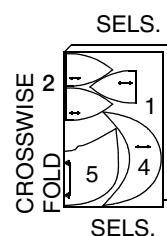


B HAT

USE PIECES 1 2 7
44" 45" (115CM)
WITH NAP
ALL SIZES

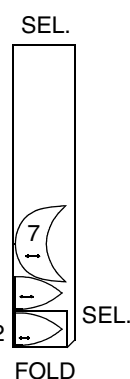

CONTRAST


USE PIECES 1 2 7
44" 45" (115CM)
WITH NAP
ALL SIZES

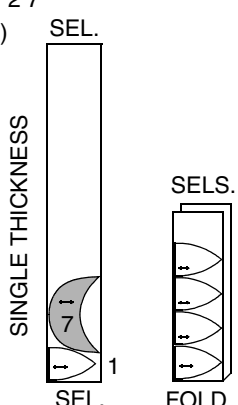

INTERFACING


USE PIECES 1 2 7

20" TO 25" (51CM TO 64CM) FUSIBLE
ALL SIZES

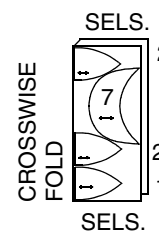

C HAT


USE PIECES 1 2 3 8
44" 45" (115CM)
WITH NAP
ALL SIZES

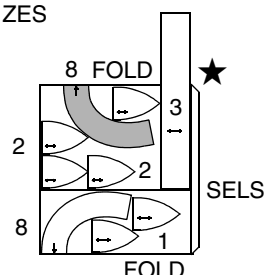

INTERFACING


USE PIECES 1 2 8

20" TO 25" (51CM TO 64CM) FUSIBLE
ALL SIZES

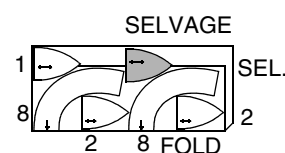


D HAT

USE PIECES 1 2 9
44" 45" (115CM)
WITH NAP
ALL SIZES

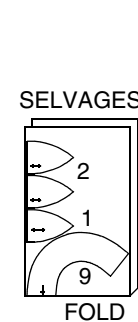


CONTRAST

USE PIECES 1 2 3 9
44" 45" (115CM)
WITH NAP
ALL SIZES

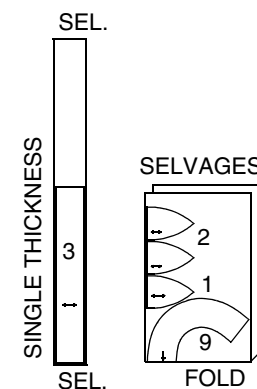


INTERFACING

USE PIECES 1 2 9
20" TO 25" (51CM TO 64CM) FUSIBLE
ALL SIZES

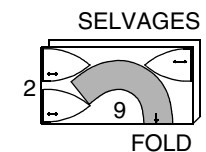


E HAT

USE PIECES 1 2 10
44" 45" (115CM)
WITH NAP
ALL SIZES

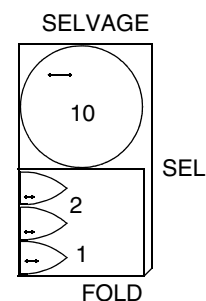


CONTRAST BRIM

USE PIECE 10
44" 45" (115CM)
WITH NAP
ALL SIZES

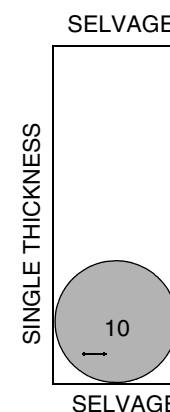


CONTRAST

USE PIECES 1 2 11
44" 45" (115CM)
WITH NAP
ALL SIZES

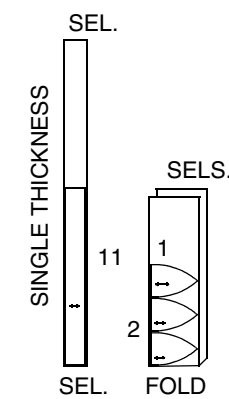


INTERFACING

USE PIECES 1 2 10
20" TO 25" (51CM TO 64CM) FUSIBLE
ALL SIZES

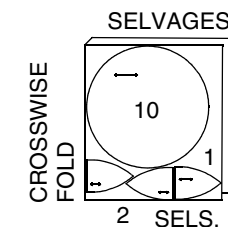


F HAT

USE PIECES 1 2 12
44" 45" (115CM)
WITH NAP
ALL SIZES

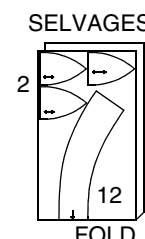


CONTRAST

USE PIECES 1 2 11 12
44" 45" (115CM)
WITH NAP
ALL SIZES

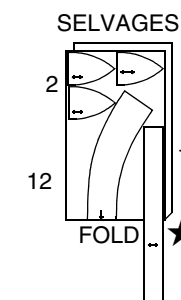


INTERFACING

USE PIECES 1 2 12
20" TO 25" (51CM TO 64CM) FUSIBLE
ALL SIZES

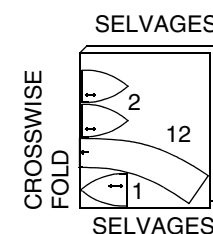

Sewing Directions

FABRIC KEY



Read **General Directions** before you begin.

SIMPLY THE BEST TECHNIQUES FOR BINDING



A. The tape comes prefolded, with one side slightly wider than the other. The wider side is to be used on the **WRONG** side of the garment so that when the tape is stitched in place from the **RIGHT** side, both edges are sure to be caught in the stitching.




Curves:

If binding is applied to a curved surface, first, preshape it with a steam iron.

B. For an inward curve, stretch the double edges and press; for an outward curve, stretch the fold edge and press.

Stitch binding with a straight **OR** decorative machine stitch.

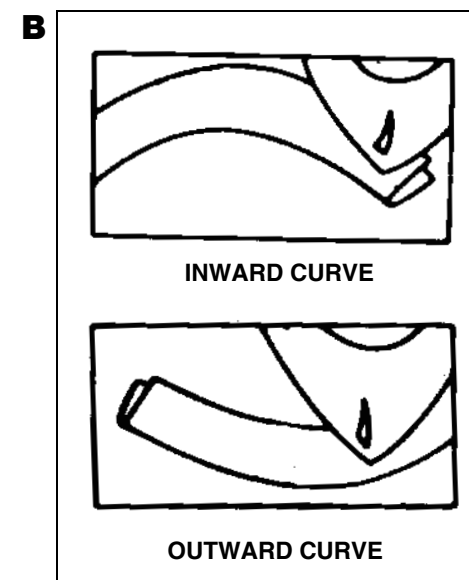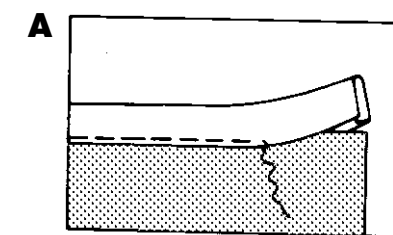

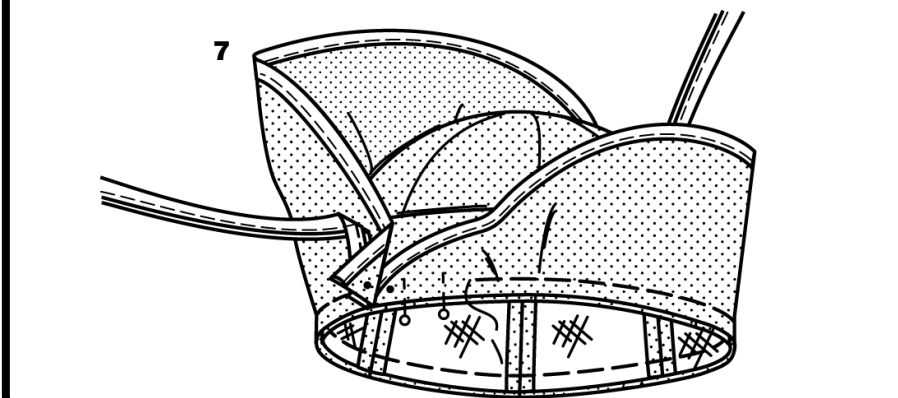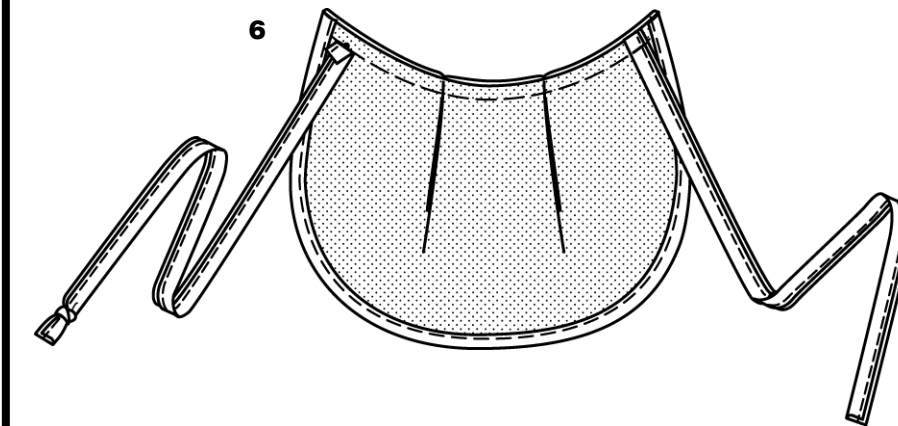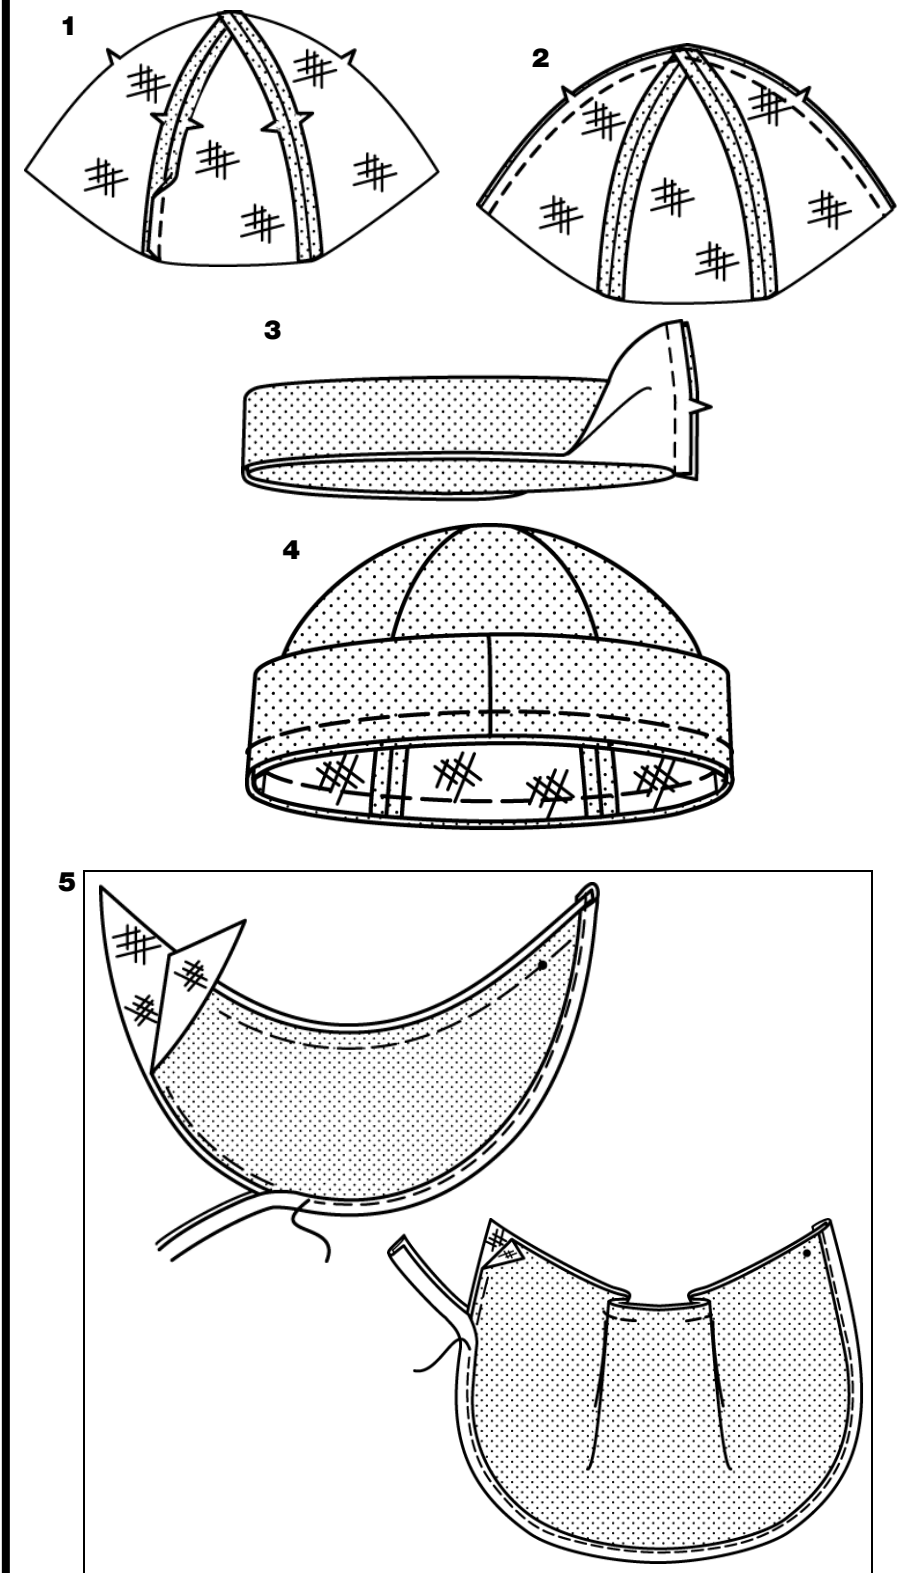

NOTE: You have cut four hat front and back, and eight hat side sections. Four hat sides and two front and backs will be referred to as lining. Hat will be stitched in a 3/8" (1cm) seam unless otherwise indicated.







HAT A

1. Apply fusible interfacing to WRONG side of each hat front and back, and each hat side section following manufacturer's directions
With RIGHT sides together, stitch a side section to each front and back section in a 1/4" (6mm) seam.
2. Stitch seams of remaining hat sections in the same manner. With RIGHT sides together, stitch the two hat sections together in a 1/4" (6mm) seam. Press.
3. Stitch notched end of hat band. Fold band in half lengthwise with WRONG sides together. Press.
4. With RIGHT sides together, pin band to hat, matching centers front and placing seam at center back. Baste.

5. Apply fusible interfacing to WRONG side of each front peak. Pin peak sections WRONG sides together. Baste along raw edges.
Apply fusible interfacing to the WRONG side of back flap following manufacturer's directions. Pin flap to flap facing, WRONG sides together. Baste along raw edges.
Apply binding to outer edge of peak and flap; see **SIMPLY THE BEST TECHNIQUES FOR BINDING**.
To make pleats on flap, on OUTSIDE, fold along solid lines. Bring folds to broken lines; pin. Baste across raw edge.

6. For ties, cut two pieces of double fold bias tape 20" (51cm) long. Stitch turned under edges together.
Pin one end of each tie to flap facing, placing end over small dot. Baste. Knot other end of tape.

7. With RIGHT sides together, pin peak to hat (over band), matching center fronts and placing small dot at side seam.
With RIGHT sides together, pin back flap to hat, matching center backs, and small dots; overlapping peak ends. Baste entire raw edge.

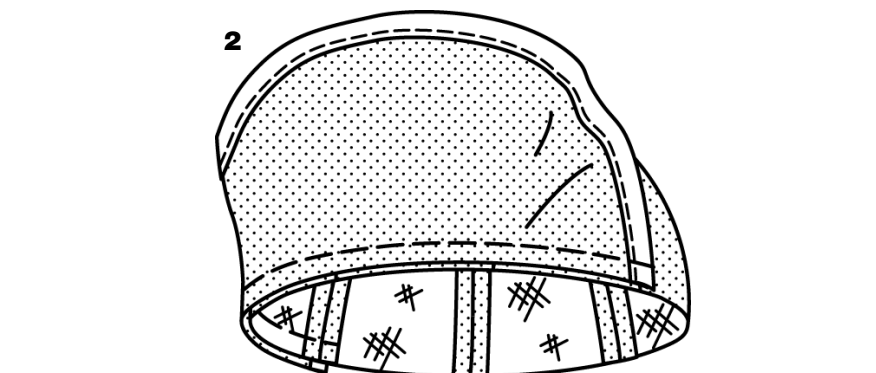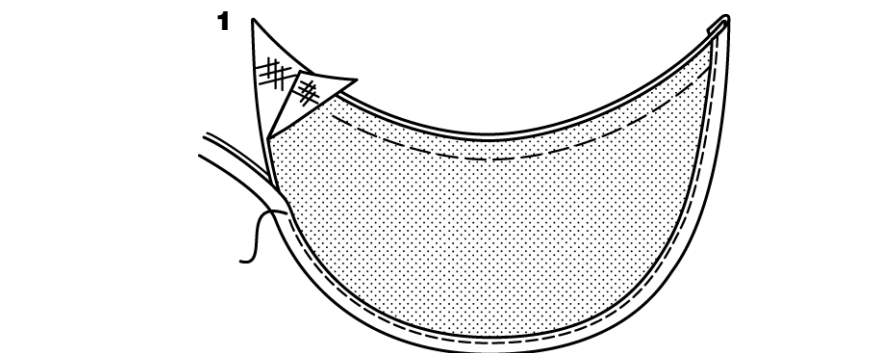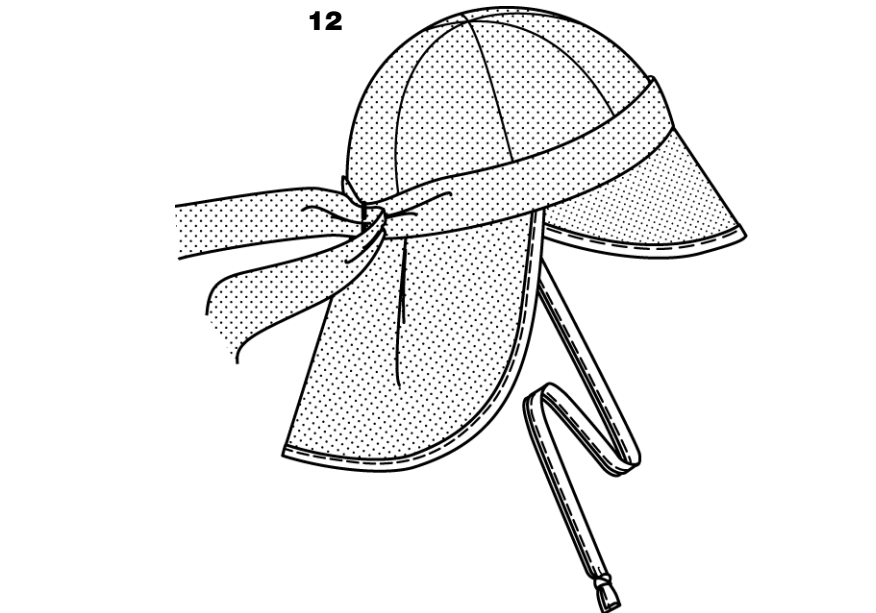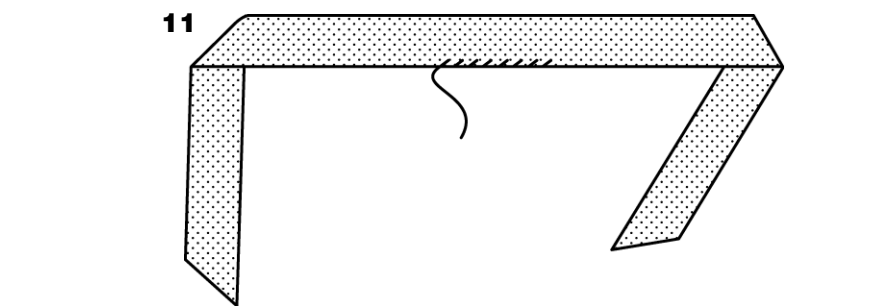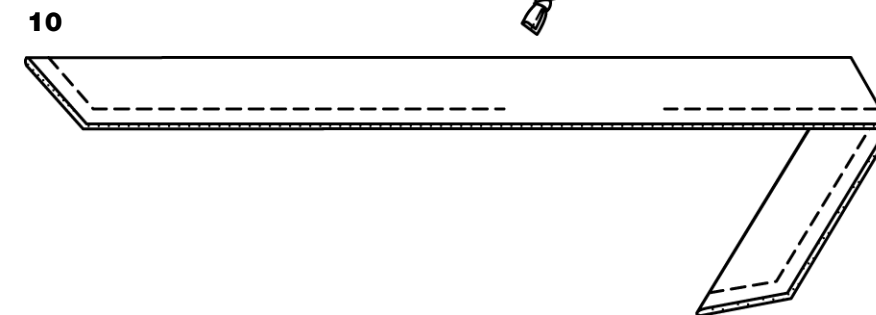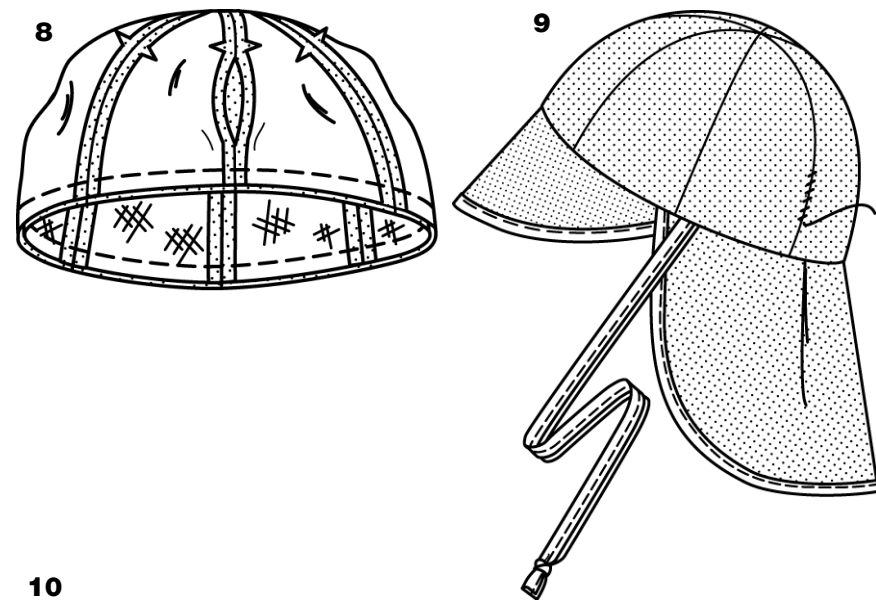

8. Stitch seams of hat lining sections same as for hat, leaving an opening in one seam for turning.
With RIGHT sides together, pin hat lining to hat (over peak, ties, and flap) having raw edges even. Stitch. Trim seam.
9. Turn hat to RIGHT side through opening in lining. Press, pressing peak, band and flap out. Slip-stitch opening.

10. Fold tie bow in half, lengthwise, with RIGHT sides together. Stitch in 3/8" (1cm) seam, leaving an opening for turning in the center.


11. Turn tie bow RIGHT side out; slip-stitch opening. Press.

12. Make a small pleat on center back seam of band and on tie bow at midpoint. Place tie over band at center back and stitch across both, through all thicknesses as shown.
Fasten tie bow in a bow.

HAT B

Prepare hat same as for Hat A; refer to steps 1 and 2.

1. Apply fusible interfacing to WRONG side of each front peak. Pin peak sections WRONG sides together. Baste along raw edges.
Apply binding to outer edge of peak; see **SIMPLY THE BEST TECHNIQUES FOR BINDING**.
2. Pin peak to hat front matching centers. Baste.

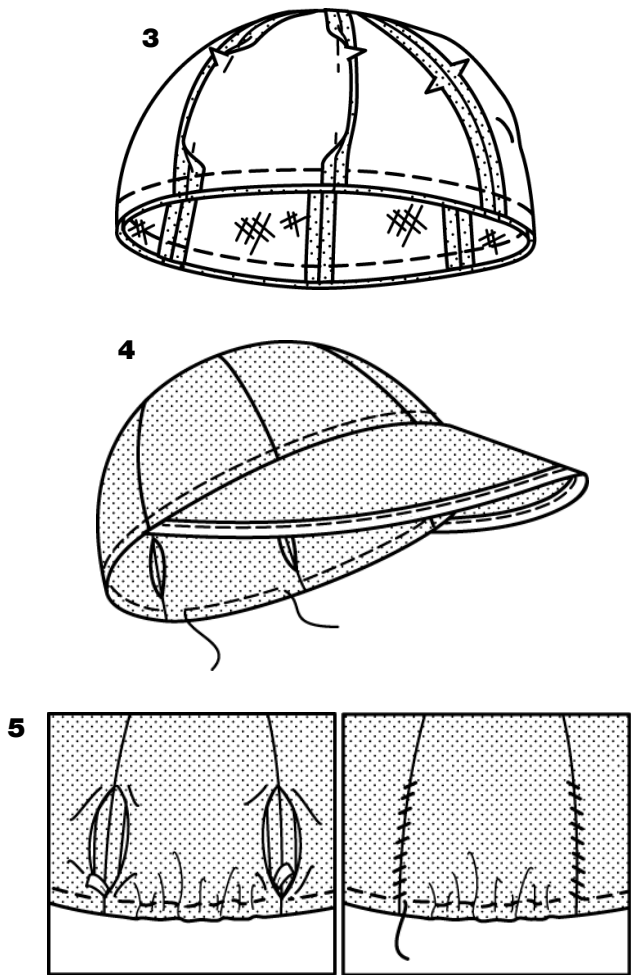

3. Stitch seams of hat lining sections same as for hat, leaving an opening at both sides of center back section.
With RIGHT sides together, pin hat lining to hat (over peak) having raw edges even. Stitch. Trim seam.

4. Turn hat to RIGHT side through one opening in lining. Press, pressing out peak.
To form casing and top-stitch lower edge of hat, on OUTSIDE, stitch 3/8" (1cm) above lower edge leaving an opening between both hat back seams to insert elastic, as shown.


5. Cut a piece of elastic the measurement of hat back. On INSIDE, insert elastic through one opening in hat lining, and then through casing, having ends of elastic extend 1/2" (1.5cm) beyond each back seam. Stitch in the ditch of hat back seams catching in elastic. Stitch openings closed. Slip-stitch openings in lining.

HATS C AND D

Prepare hat same as for Hat A; refer to steps 1 though 4.

1. Apply fusible interfacing to WRONG side of each hat brim section for view C, and to WRONG side of one hat brim section for view D, following manufacturer's directions. Stitch center back seam of hat brim.

2. Stitch center back seam of hat brim facing. With RIGHT sides together, stitch facing to hat brim along lower edge, matching seams. Trim seam; clip curves.

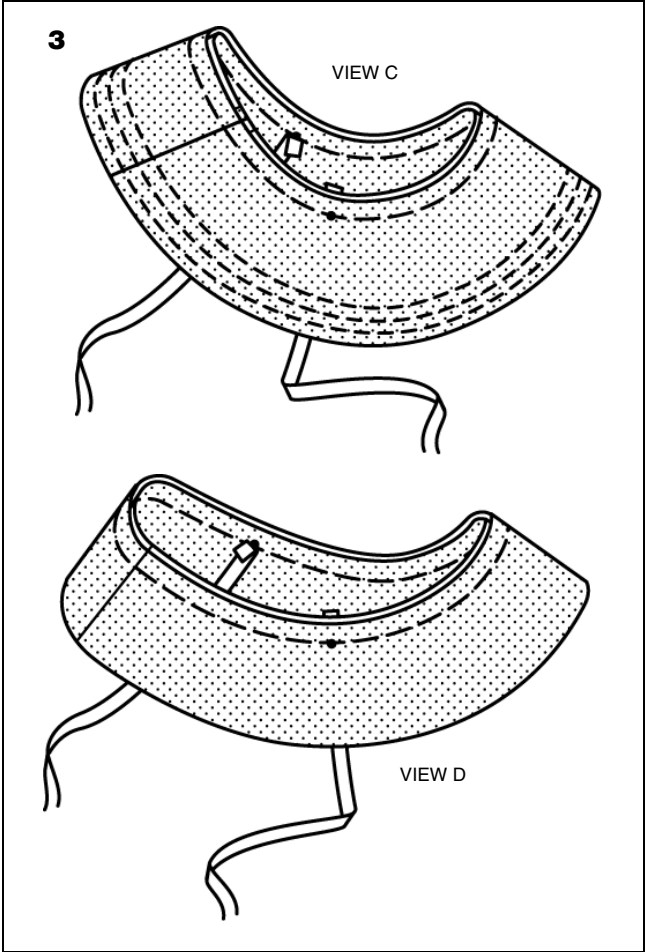


3. Turn hat brim RIGHT side out; press. Baste raw edges together.
FOR VIEW C -Top-stitch 3/8" (1cm) from finished edge of brim; then stitch two more rows 1/4" (6mm) from the first.
FOR VIEWS C, D - For ties, cut ribbon in half. Place one end of each tie at small dot on brim facing, having raw edges even. Baste. Knot other end.

4. Turn hat RIGHT side out. On OUTSIDE, with RIGHT sides together, pin brim to lower edge of hat (over band), matching centers and placing small dots at side seams. Baste.

5. Stitch seams of hat lining same as for hat, leaving an opening in one seam for turning. With RIGHT sides together, pin lining to hat (over brim), matching seams and having raw edges even. Stitch. Trim seam.

6. Turn hat RIGHT side out through opening in lining; press. Slip-stitch opening.

7. FOR VIEW C - On OUTSIDE, pin braid to band, placing one edge along brim seam, turning under and lapping ends at back seam. Stitch close to upper edge of braid, keeping hat free. On OUTSIDE, hand-sew flower to band, as shown on front of pattern envelope.
FOR VIEW D - On OUTSIDE, hand-sew button and flower to band, as shown on front of pattern envelope.

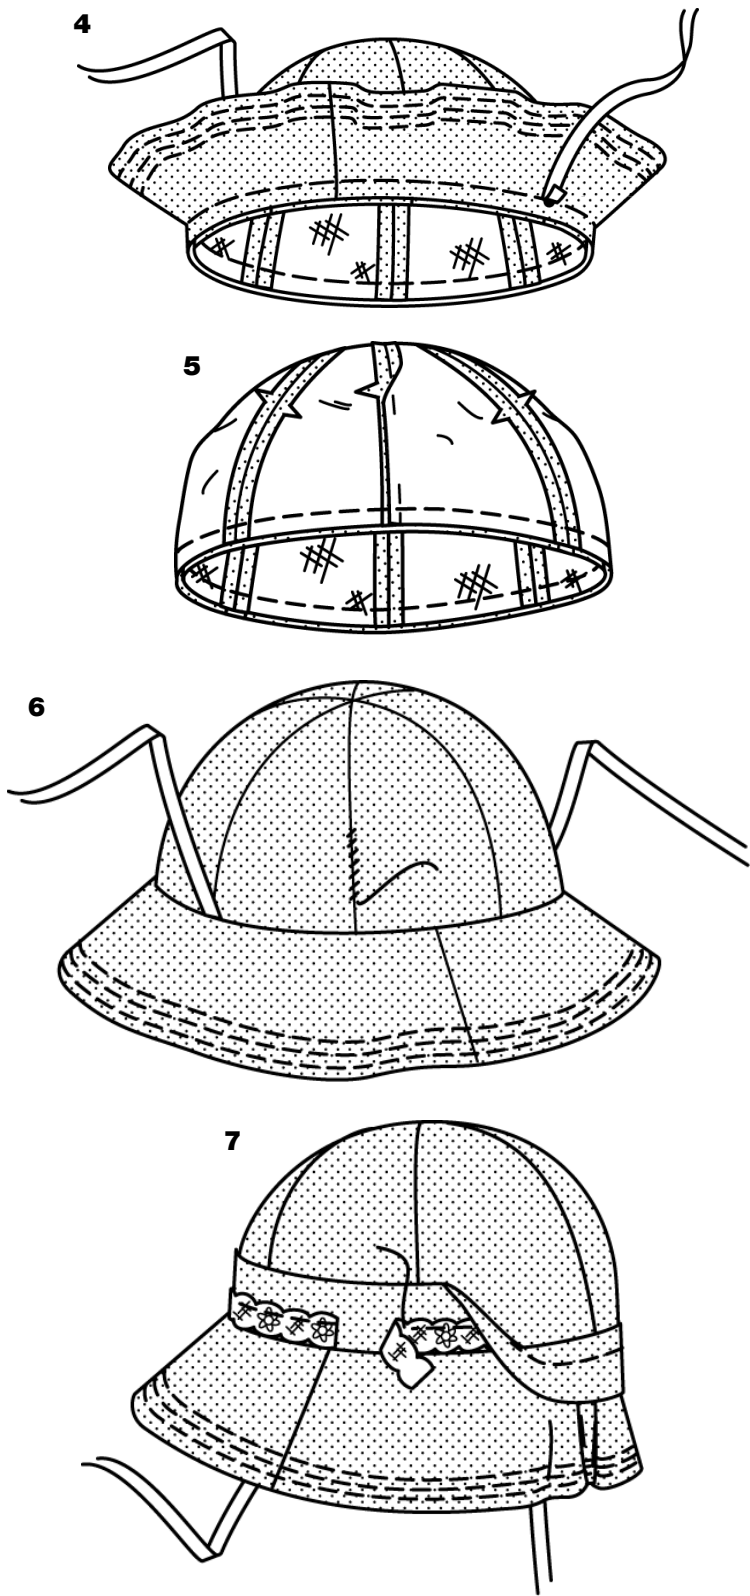

1682

4 / 4

HAT E

Prepare hat same as for Hat A; refer to steps 1 though 4.

1. Apply fusible interfacing to WRONG side of each hat brim section, following manufacturer's directions. With RIGHT sides together, stitch facing to hat brim along lower edge, matching seams. Trim seam; clip curves.


2. Turn hat brim RIGHT side out; press. Baste raw edges together.
For ties, cut twill tape in half. Place one end of each tie at small dot on brim facing, having raw edges even. Baste. Knot other end.

3. Turn hat RIGHT side out. On OUTSIDE, with RIGHT sides together, pin brim to lower edge of hat (over band), matching centers and placing small dots at side seams.

4. Stitch seams of hat lining same as for hat, leaving an opening in one seam for turning. With RIGHT sides together, pin lining to hat (over brim), matching seams and having raw edges even.

5. Turn hat RIGHT side out through opening in lining; press. Slip-stitch opening.

6. On OUTSIDE, pin wavy trim to hat, centering trim over finished edge of brim and folding under ends. Stitch along center of trim.

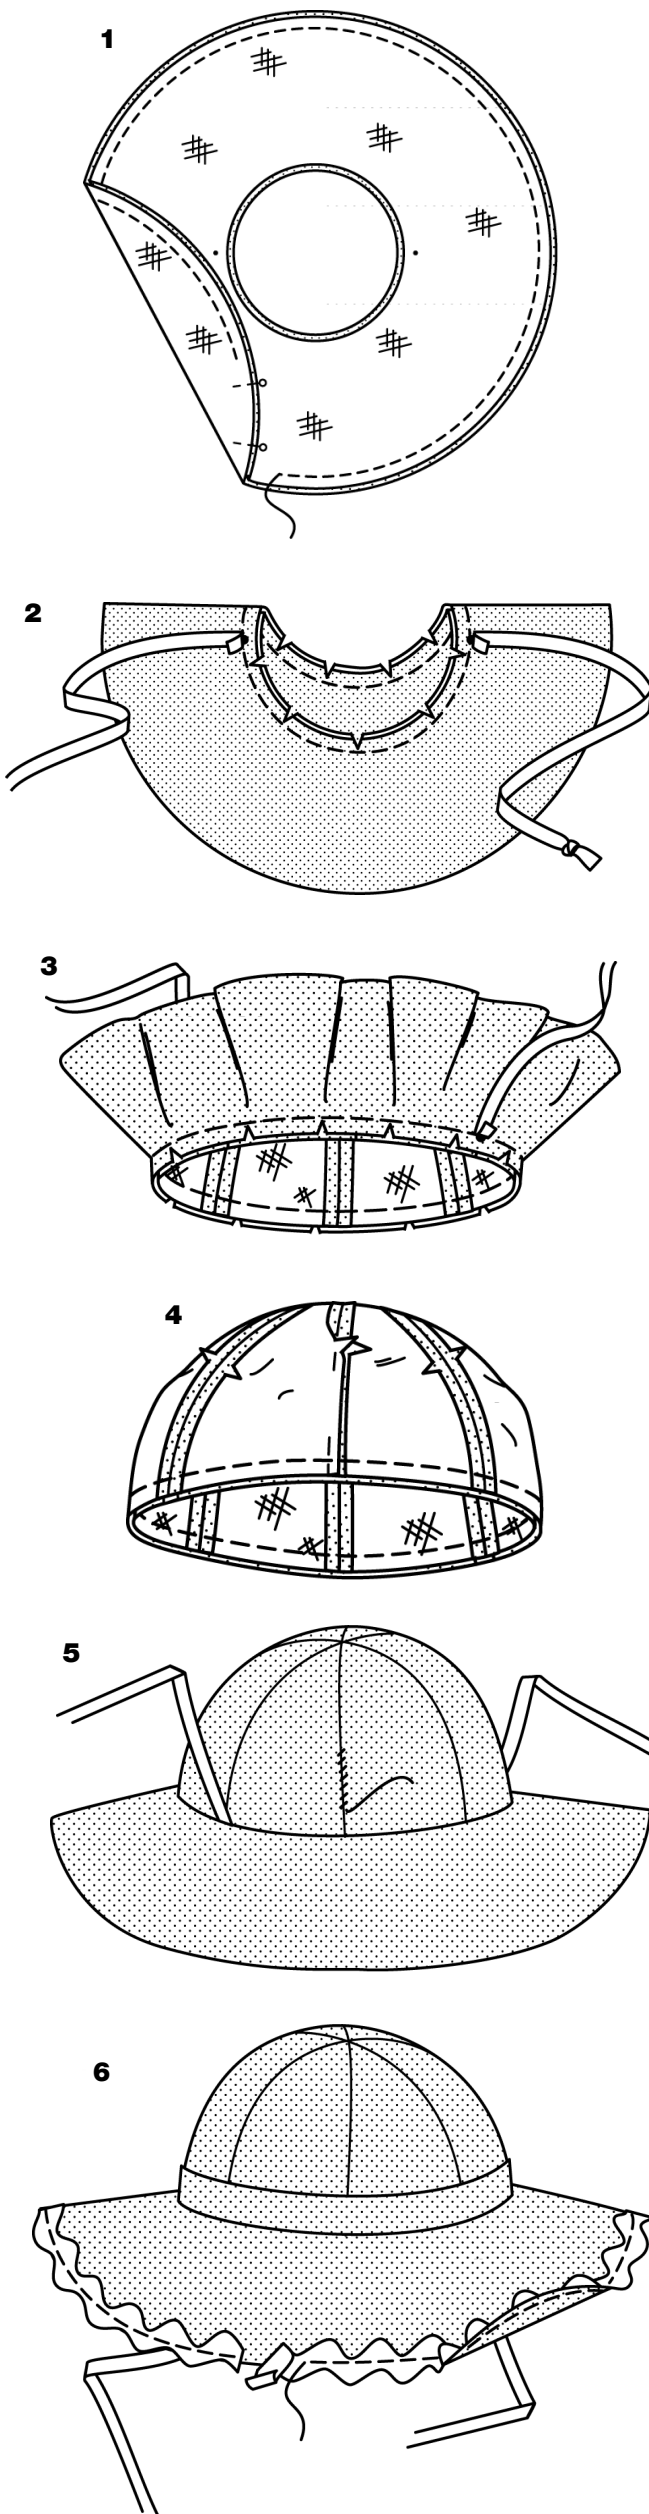

HAT F

Prepare hat same as for Hat A; refer to steps 1 though 4.

1. Apply fusible interfacing to WRONG side of one hat brim section, following manufacturer's directions. Stitch center back seam of hat brim.

2. Stitch center back seam of hat brim facing. With RIGHT sides together, stitch facing to hat brim along lower edge, matching seams. Trim seam.

3. Turn hat brim RIGHT side out; press. Baste raw edges together. To gather brim stitch along seam line and 1/8" (3mm) INSIDE seam line, using a long machine-stitch. Top-stitch close to finished edge of brim.
For ties, cut ribbon in half. Place one end of each tie at small dot on brim facing, having raw edges even. Baste. Knot other end.

4. Turn hat RIGHT side out. On OUTSIDE, pin brim to lower edge of hat (over band), matching centers and placing small dots at side seams. Pull up gathering stitches to fit. Baste.

5. Stitch seams of hat lining same as for hat, leaving an opening in one seam for turning. With RIGHT sides together, pin lining to hat (over brim), matching seams and having raw edges even.

6. Turn hat RIGHT side out through opening in lining; press. Slip-stitch opening closed.
On OUTSIDE, hand-sew button and flower to band, as shown on front of pattern envelope.

